define®


Technical Specification

CLICK® Scolmore GROUP

Product Code: FPMB100BK

Luckinslive 439634351

Description: 115V/230V Dual Voltage Shaver Socket Outlet

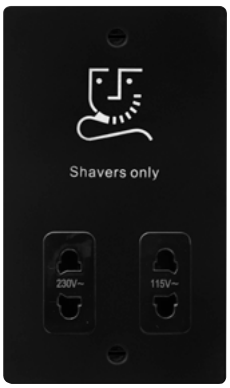



General Information

Dimensions (mm)	88 (W) x 146 (H) x 45 (D)		
Plate Dimensions (mm)	86 (W) x 146 (H) x 1.3 (D)		
Dimensions With Gasket (mm)	86 (W) x 146 (H) x 3 (D)		
Plate Fixing Centres - Vertical (mm)	120.6		
Style	Flat Plate		
Finish	Matt Black		
Insert Colour	Black		
Gasket Colour	Transparent (Neoprene)		
Supplied Fixing Screw Finish	Matt Black		
Materials	Front Plate: Stainless Steel	Insert & Rear Housing: Urea	
	Terminals: Brass	Terminal Screws: Steel & Yellow Passivated	
	Contacts: Silver "on-lay" Copper / Brass	Internal Busbars: Formed Pressed Brass	
	Earth Strap: Mild Steel		
Anti Microbial Certified	No		
Operating Voltage (AC)	220-240	Frequency (Hz)	50/60
Load Rating @115V (Va)	20		
Load Rating @230V (Va)	20		
Thermal Protection Device	PTC Resettable Fuse		
Termination Type	Screw		
Terminal Size (mm)	Ø3.5	Terminal Torque Value (Nm)	0.5
Terminal Capacity - Solid (mm^2)	2 x 1.5 or 1 x 2.5		
Socket Features	Safety Interlock Shutter		
Twin Earth Terminals	Yes		
Product Marking	Shavers Only, 230V~, 115V~		
Minimum Back Box Depth (mm)	47		
Ingress Protection	IP20		
Operational Temperature (°C)	-5 to +40		
Warranty (Years)	20	Warranty - Electronics (Years)	2

Standards BS EN IEC 61558-1, BS EN 61558-2-5

Additional Information

For cleaning / polishing of products, use only a soft, dry, clean cloth.
This outlet is not continuously rated and therefore not suitable for use as a permanent charging outlet.
CLICK dual voltage shaver outlets incorporate a double wound isolating transformer rated 20Va at 230V or 115V and meets BS EN 61558-2-5:2010 making it safe for use in bathrooms.
PTC resettable fuses increase resistance as temperature increases due to increased flow. PTC resettable fuses are designed to limit unsafe currents while allowing constant safe current levels, resistance will "reset" automatically when the fault is removed and temperature returns to a safe level.
Ensure that the mains supply is isolated before commencing installation and refer to the circuit diagram with the relevant product.
Bare earth cables must always be covered with appropriate sleeving and wired to the earth terminal.

Scolmore House, Mariner, Lichfield Road Industrial Estate,
Tamworth, Staffordshire, B79 7UL United Kingdom
T: +44 (0)1827 63454 | **F:** +44 (0)1827 63362
E: sales@scolmore.com | **W:** scolmore.com

CE UKCA

CLICK OR SCAN Catalogue Range DoC Installation CLICK OR SCAN